


Comparison of 1987 and 2011
Photographs of Watts Towers Sculptures

Ship

April 18, 2012





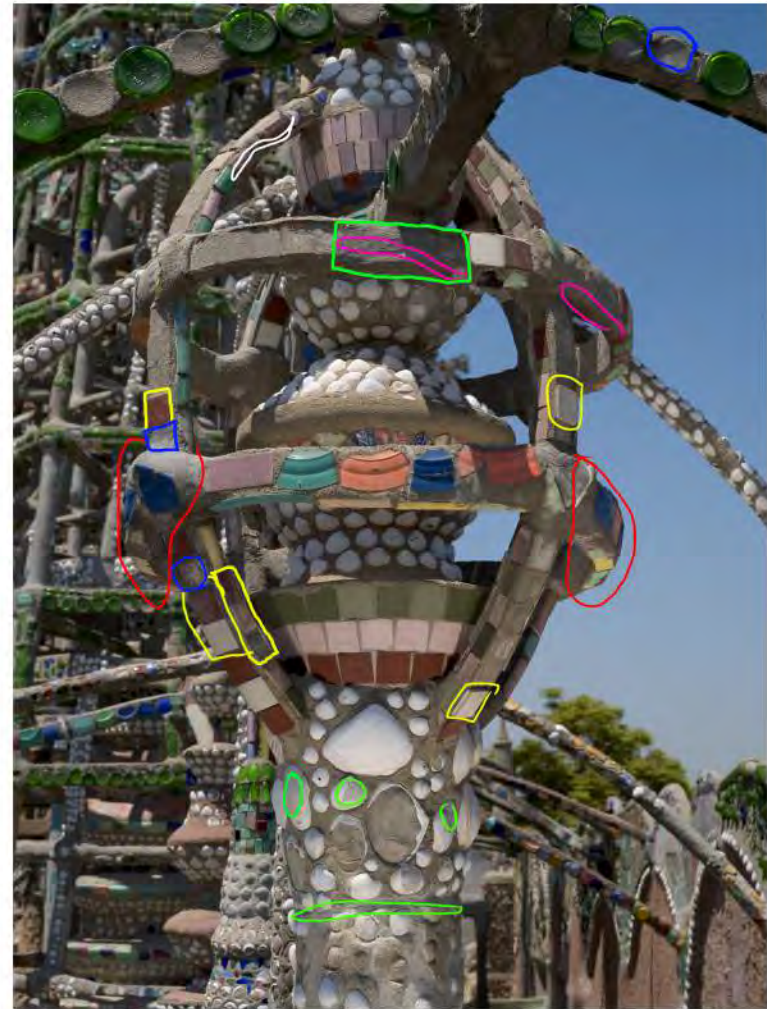









1987: Spire 5 looking west, bands 1-2



2011

Legend

| | | | | | |
|---|---|---|---|---|---|
|  |  |  |  |  |  |
| Crack Fill | Uncovered Ornament | Mortar Reattachment | New Damage | New Mortar Application | Missing Ornament |
|  |  |  |  |  |  |
| Removed Treatment Prior to 1987 | Added/Rearranged Ornament | Lost Ornament Impression | Treatment Prior to 1987 | New Ornament Impression | Altered Shape or Contour |

NOTE: Dashed line indicates uncertainty/need of verification















1987: Spire 5 looking east



2011


Legend

| | | | | | |
|---|---|--|---|---|---|
|  |  |  |  |  |  |
| Crack Fill | Uncovered Ornament | Mortar Reattachment | New Damage | New Mortar Application | Missing Ornament |
|  |  |  |  |  |  |
| Removed Treatment Prior to 1987 | Added/Rearranged Ornament | Lost Ornament Impression | Treatment Prior to 1987 | New Ornament Impression | Altered Shape or Contour |

NOTE: Dashed line indicates uncertainty/need of verification





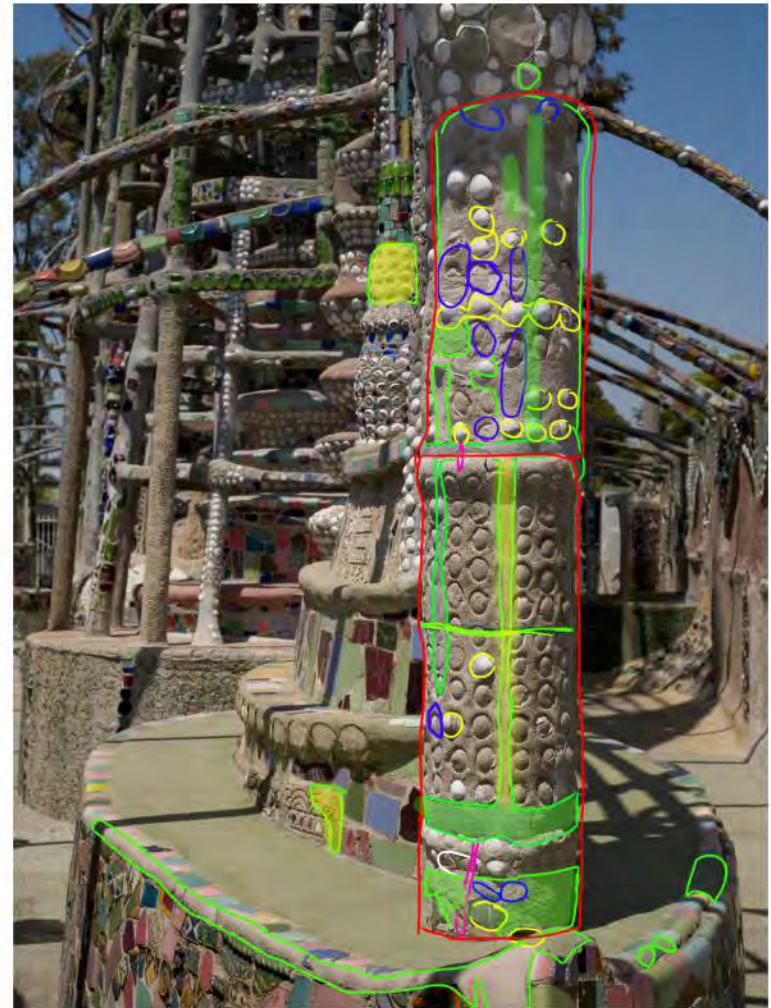









1987: Spire 5 looking west, levels 2-3



2011

Legend

| | | | | | |
|---|---|---|---|---|---|
|  |  |  |  |  |  |
| Crack Fill | Uncovered Ornament | Mortar Reattachment | New Damage | New Mortar Application | Missing Ornament |
|  |  |  |  |  |  |
| Removed Treatment Prior to 1987 | Added/Rearranged Ornament | Lost Ornament Impression | Treatment Prior to 1987 | New Ornament Impression | Altered Shape or Contour |

NOTE: Dashed line indicates uncertainty/need of verification















1987: South side looking northeast



2011

Legend

| | | | | | |
|---|---|--|---|---|---|
|  |  |  |  |  |  |
| Crack Fill | Uncovered Ornament | Mortar Reattachment | New Damage | New Mortar Application | Missing Ornament |
|  |  |  |  |  |  |
| Removed Treatment Prior to 1987 | Added/Rearranged Ornament | Lost Ornament Impression | Treatment Prior to 1987 | New Ornament Impression | Altered Shape or Contour |

NOTE: Dashed line indicates uncertainty/need of verification















1987: South side looking northeast



2011

Legend

| | | | | | |
|---|---|--|---|---|---|
|  |  |  |  |  |  |
| Crack Fill | Uncovered Ornament | Mortar Reattachment | New Damage | New Mortar Application | Missing Ornament |
|  |  |  |  |  |  |
| Removed Treatment Prior to 1987 | Added/Rearranged Ornament | Lost Ornament Impression | Treatment Prior to 1987 | New Ornament Impression | Altered Shape or Contour |

NOTE: Dashed line indicates uncertainty/need of verification













1987: Spire 1 looking southeast



2011

Legend

| | | | | | |
|---|---|--|---|---|---|
|  |  |  |  |  |  |
| Crack Fill | Uncovered Ornament | Mortar Reattachment | New Damage | New Mortar Application | Missing Ornament |
|  |  |  |  |  |  |
| Removed Treatment Prior to 1987 | Added/Rearranged Ornament | Lost Ornament Impression | Treatment Prior to 1987 | New Ornament Impression | Altered Shape or Contour |

NOTE: Dashed line indicates uncertainty/need of verification















1987: North side looking southeast



2011


Legend

| | | | | | |
|---|---|--|---|---|---|
|  |  |  |  |  |  |
| Crack Fill | Uncovered Ornament | Mortar Reattachment | New Damage | New Mortar Application | Missing Ornament |
|  |  |  |  |  |  |
| Removed Treatment Prior to 1987 | Added/Rearranged Ornament | Lost Ornament Impression | Treatment Prior to 1987 | New Ornament Impression | Altered Shape or Contour |

NOTE: Dashed line indicates uncertainty/need of verification





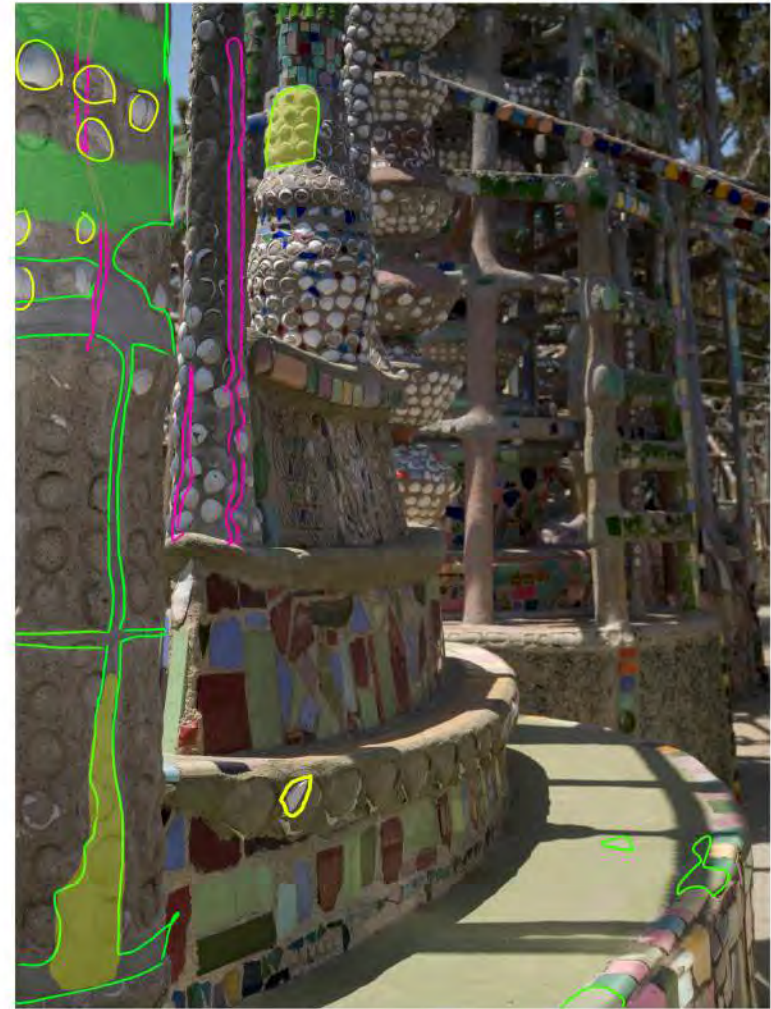









1987: North side looking west, levels 1-3



2011

Legend

| | | | | | |
|---|---|---|---|---|---|
|  |  |  |  |  |  |
| Crack Fill | Uncovered Ornament | Mortar Reattachment | New Damage | New Mortar Application | Missing Ornament |
|  |  |  |  |  |  |
| Removed Treatment Prior to 1987 | Added/Rearranged Ornament | Lost Ornament Impression | Treatment Prior to 1987 | New Ornament Impression | Altered Shape or Contour |


NOTE: Dashed line indicates uncertainty/need of verification



1987: Base of north side looking west



2011

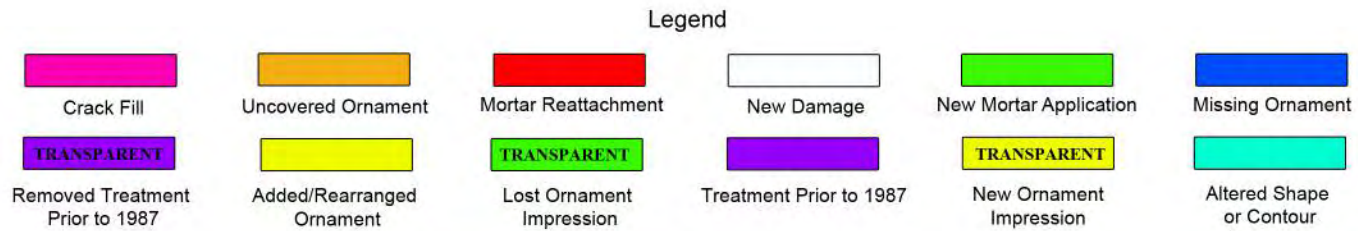

NOTE: Dashed line indicates uncertainty/need of verification















1987: Base of north side center C and center D



2011

Legend

| | | | | | |
|---|---|---|---|---|---|
|  |  |  |  |  |  |
| Crack Fill | Uncovered Ornament | Mortar Reattachment | New Damage | New Mortar Application | Missing Ornament |
|  |  |  |  |  |  |
| Removed Treatment Prior to 1987 | Added/Rearranged Ornament | Lost Ornament Impression | Treatment Prior to 1987 | New Ornament Impression | Altered Shape or Contour |


NOTE: Dashed line indicates uncertainty/need of verification



1987: Base of north side looking east, center A and B



2011

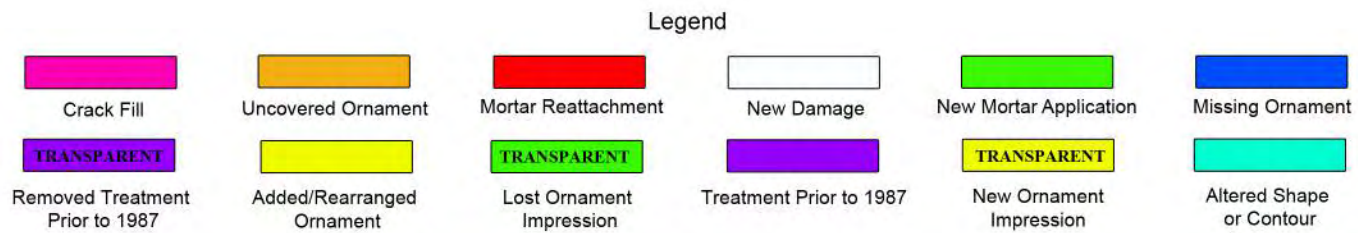

NOTE: Dashed line indicates uncertainty/need of verification















1987: Base of north side looking southeast, west A and B




2011


Legend

| | | | | | |
|---|---|--|---|---|---|
|  |  |  |  |  |  |
| Crack Fill | Uncovered Ornament | Mortar Reattachment | New Damage | New Mortar Application | Missing Ornament |
|  |  |  |  |  |  |
| Removed Treatment Prior to 1987 | Added/Rearranged Ornament | Lost Ornament Impression | Treatment Prior to 1987 | New Ornament Impression | Altered Shape or Contour |

NOTE: Dashed line indicates uncertainty/need of verification

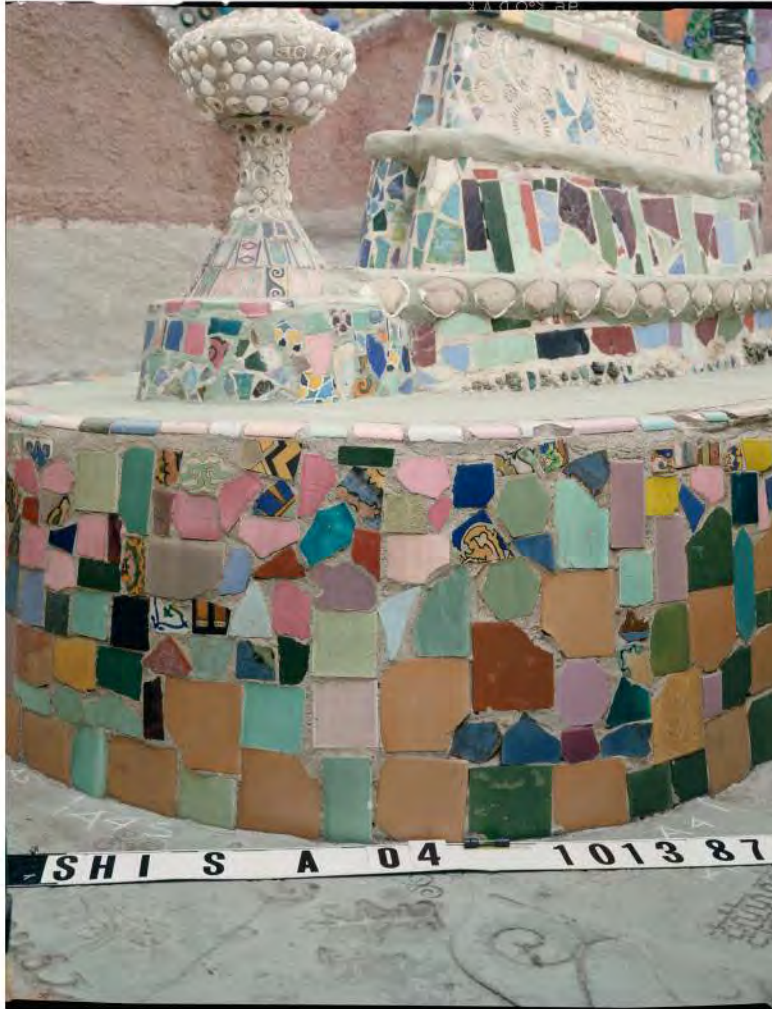



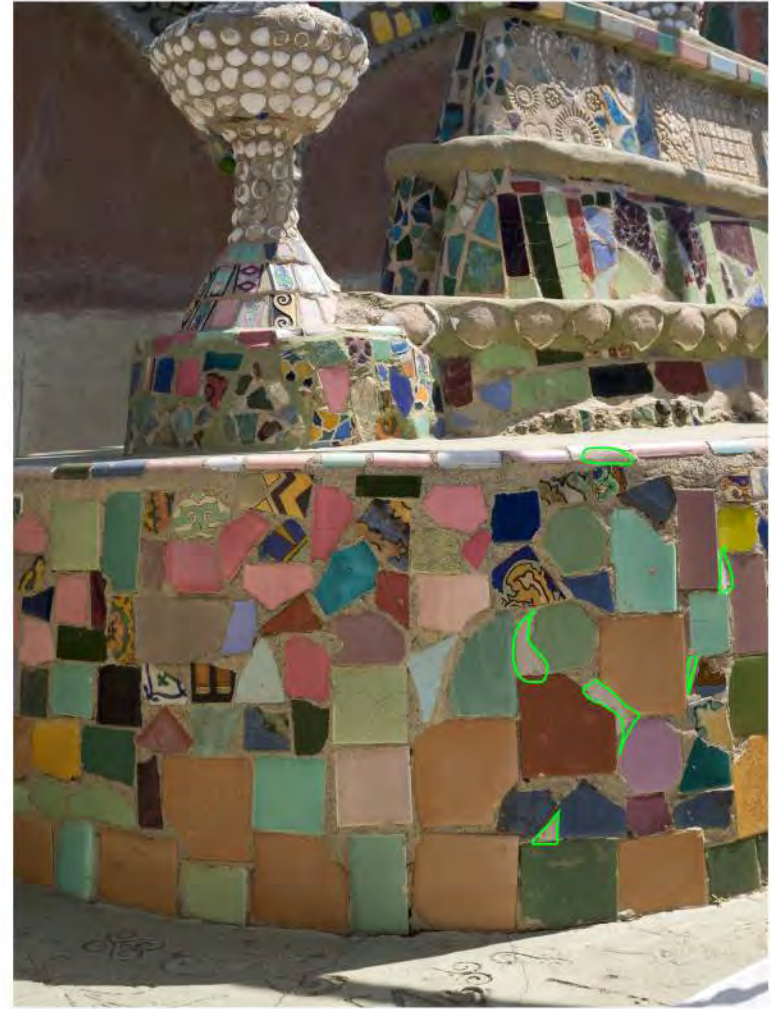








1987: Base of south side, west A and B



2011

Legend

| | | | | | |
|---|---|---|---|---|---|
|  |  |  |  |  |  |
| Crack Fill | Uncovered Ornament | Mortar Reattachment | New Damage | New Mortar Application | Missing Ornament |
|  |  |  |  |  |  |
| Removed Treatment Prior to 1987 | Added/Rearranged Ornament | Lost Ornament Impression | Treatment Prior to 1987 | New Ornament Impression | Altered Shape or Contour |

NOTE: Dashed line indicates uncertainty/need of verification














1987: Base of south side, center A and B



2011

Legend

| | | | | | |
|---|---|---|---|---|---|
|  |  |  |  |  |  |
| Crack Fill | Uncovered Ornament | Mortar Reattachment | New Damage | New Mortar Application | Missing Ornament |
|  |  |  |  |  |  |
| Removed Treatment Prior to 1987 | Added/Rearranged Ornament | Lost Ornament Impression | Treatment Prior to 1987 | New Ornament Impression | Altered Shape or Contour |

NOTE: Dashed line indicates uncertainty/need of verification















1987: Base of south side looking west, center A and B



2011


Legend

| | | | | | |
|---|---|--|---|---|---|
|  |  |  |  |  |  |
| Crack Fill | Uncovered Ornament | Mortar Reattachment | New Damage | New Mortar Application | Missing Ornament |
|  |  |  |  |  |  |
| Removed Treatment Prior to 1987 | Added/Rearranged Ornament | Lost Ornament Impression | Treatment Prior to 1987 | New Ornament Impression | Altered Shape or Contour |


NOTE: Dashed line indicates uncertainty/need of verification



1987: Base of south side looking west, east A and B

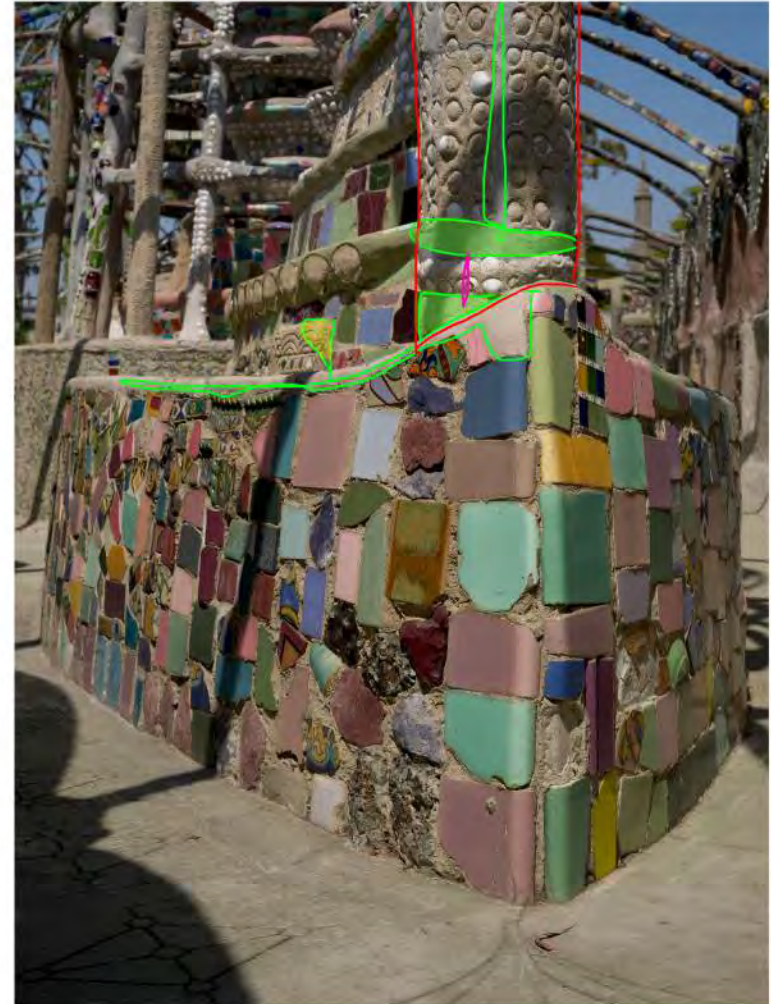

2011

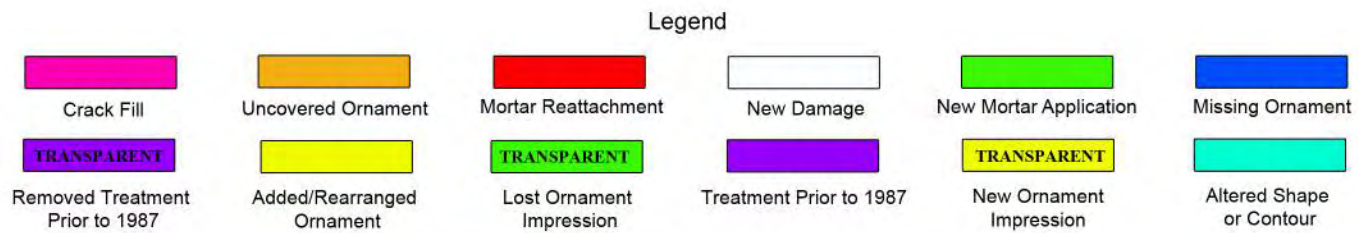

NOTE: Dashed line indicates uncertainty/need of verification